




1120 North Main Street • Elkhart, IN 46514
PHONE: 574•264•2131 FAX: 574•206•9713
INTERNET: <http://www.atwoodmobile.com>

LITERATURE NUMBER **MPD 53408**

TOP PILOT ASSEMBLY REPLACEMENT

Effective 11/21/07

For complete Wedgewood range
& cooktop instructions consult
MPD 56280.

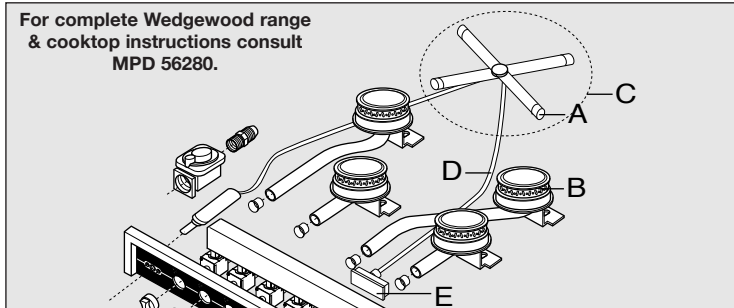

WARNING **EXPLOSION OR FIRE**

- Improper installation, adjustment, alteration, service or maintenance can cause injury or property damage.
- Refer to MPD 56280 for complete instructions.
- For assistance or additional information consult Atwood Consumer Service Department, a qualified installer, service agency or the gas supplier.
- Follow directions exactly for proper installation, adjustment, service and maintenance.

REMOVAL PROCEDURE-

1. Turn off gas supply using appliance shut off valve or valve on gas bottles.

2. Remove range top and disconnect flash tubes -A from top burners-B by sliding flash tubes away from burners.

3. Remove two screws securing top pilot assembly to burner box.

4. Disconnect pilot gas line-D at pilot gas valve-E.

5. Remove top pilot assembly-C.

INSTALLATION PROCEDURE-

1. Install new top pilot assembly by following the above instructions in reverse order.
2. Turn on gas supply to appliance.
3. Check all connections for gas leaks using a non-corrosive leak detection fluid. Do not use a soap and water solution. Leak testing in excess of 8 oz. per square inch (1/2 psi) of air pressure will invalidate warranty.

Aftermarket Replacement Service Part

Quarter page actual size
(Shown enlarged)