


IMPORTANT: REIGNITOR REPLACEMENT INFORMATION

**REFRIGERATOR
BULLETIN R68/3A
JUNE 1993**

RE: CHANNEL PRODUCTS MARK 6, MODEL 12E REIGNITOR

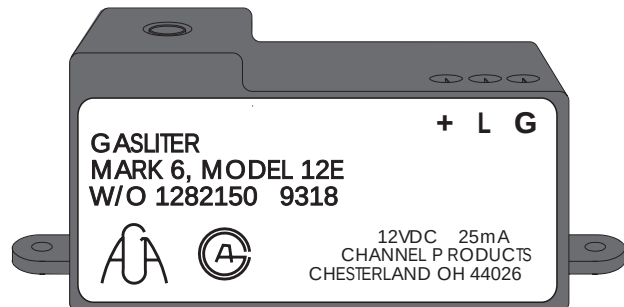

DO NOT install the Channel Mark 6, Model 12E Reignitor (shown above) as a service replacement part on the following:

DOMETIC REFRIGERATOR MODELS:

RM2607	RM2807	RM3607
RM2611	RM2811	RM3807

SILHOUETTE REFRIGERATOR MODELS:

S1521	S1621	S1821
S1531	S1631	S1831

The reignitor installed on the above refrigerators as original equipment is part number 2931132019 (RV Gas Model 679). This reignitor is rated 50 MA and **must** be used on all models listed above. This reignitor may also be used on any other model.

If you require a reignitor for these refrigerators, please contact your distributor.

Installing the Channel Mark 6, Model 12E, rated 25 MA, on those models previously listed can result in failure to ignite on gas if the DC power supply is below 12.5 volts DC. The reignitor will see low voltage and not produce a spark, resulting in flame failure lock-out.

Installation of the Channel Products, Inc. Gasliter Mark 6, Model 12E, will **VOID** the Warranty on the previously listed models. All other refrigerator models not listed in this Bulletin can continue to use the 7679100003 Reignitor. Substitution of 2931132019 for 7679100003 is acceptable.

Please inspect your reignitor parts inventory under part number 2931132019 and purge all reignitors not rated 50 MA into a separate inventory located under part number 7679100003.